

Section A. Details of the client/Person ordering the report

Name:

Address:

Section B. Reason for producing this report

Landlord 5 year electrical safety test

Date(s) on which inspection and testing was carried out

22-May-2020

Section C. Details of the installation which is subject of this report

Occupier Richa

Richard May

Site Address

Description Of Premises Domestic

Estimated age of wiring system 14 Year(s)

Evidence of additions/alterations

Yes

Installation record available?(651.1)

No

Date of last inspection

1-Jan-2010

if yes, estimated age year(s)

Section D. Extent and Initations of inspecting and tes

Extent of the electric sinstallation covered by his repo

- 1. The electrical installation with the poperty described in stetail of the in-
- 2. The electrical installation with the poleonic area of the pulling and
- 3. N/A

Agreed limitations including the reasons (See Regulation 653.2)

- 1. Supplier's fuse sealed, cannot inspect internally
- 2. No live testing to off-peak circuits.
- 3. No access to origin of supply for building.
- 4. No communal areas tested or inspected.
- 5. No design information available.
- 6. Live and neutral insulation resistance testing omitted
- 7. N/A

gasele

Agreed with:

Operational limitations including the reasons

The inspection and testing detailed in this report and accompanying schedules have been carried out in accordance with BS 7671:2018 (IET wiring regulations) as amended to: **2018**

It should be noted that cable concealed within trunking and conduits, under floors, in roof spaces, and generally within fabric of the building or underground, have not been inspected unless specifically agreed between the client and inspector prior to the inspection. An inspection should be made within an accessible roof space housing other electrical equipment.

Section E. Summary of the condition of the installation

General condition of the installation (in terms of electrical safety) Good

Overall assessment of the installation in terms of its suitability for continued use

Unsatisfactory

Certificate no. 1512008



Electrical Installation Condition Report - EICR

*An unsatisfactory assessment indicates that dangerous (C1) and/or potentially dangerous (C2) conditions have been identified.

Section F. Recommendations

Where the overall assessment of the suitability of the installation for continued use is 'unsatisfactory', I/we recommend that any observations classified as 'Danger present' (Code C1) or 'potentially dangerous' (Code C2) are acted upon as a matter

Investigation without delay is recommended for observations identified as 'Requiring further investigation' (code FI). Observations classified as 'Improvement recommended' (Code C3)' should be given due consideration.

Subject to the necessary remedial action being taken, I/we recommend that the installation is further inspected and tested by 22-May-2025

Section G. Declaration

I/We, being the persons(s) responsible for the inspection and testing of the electrical installation (as indicated by my/our signatures below), particulars of which are described above, having exercised reasonable skill and care when carrying out the inspection and testing, hereby declare the information in this report, including the observations and the attached schedules, provides an accurate assessment of the condition of the electrical installation taking into account the stated extent and limitations in Section D of this report.

INSPECTED AND TESTED BY:

Name

Date

Signature

For/on behalf of

Position

Address

Somerton, Somerset, TA11 7JQ,

Section H. Schedule(s)

1 schedule(s) of inspection and 1 schedule(s) of test results are attached.

The attached schedule(s) are part of this document and this report is valid only when they are attached to it.

Section I. Supply characteristics and earthing arrangements

22-May-2020

occion il cuppiy cii	uraotoriotico aria cartining arrango	TOTAL CONTROL OF THE PROPERTY	
EARTHING ARRANGEMENT	NUMBER AND TYPE OF LIVE CONDUCTORS	NATURE OF SUPPLY PARAMETERS	SUPPLY PROTECTIVE DEVICE
LIM	a.c 1Ph 2 Wire Confirmation of Yes supply polarity	Nominal voltage,U/U 230 V Nominal frequency, f. 50 Hz Prospective fault current, Ipf(2) 0.82 kA External loop impedance Ze 0.28 Note:(1) by enquiry (2) by enquiry or by measurement	BS(EN) LIM Type: LIM Rated Current: LIM A

Other sources of supply (As detailed on attached schedule)

No

Certificate no. 1512008



Electrical Installation Condition Report - EICR

Section J. Particulars of installation referred to in report

MEANS OF EARTHING

DETAILS OF INSTALLATION EARTH ELECTRODE

Distributor's facility

N/A Type

Installation earth

Location N/A Resistance to Earth N/A

electrode

Main protective conductor			
Earthing conductor	Material Copper	CSA 16 mm	Connection/continuity verified Yes
Main protective bonding			
conductors	Material Copper	CSA 10 mm	Connection/continuity verified Yes
To water installation pipes Yes	To gas installation pipes N/A	To oil installation pipes N/A	To structural steel N/A
To lightning protection N/A	To other incoming services	N/A N/A	

Main switch/switch-fuse/circuit-breaker/RCD

No

DB in cupboard outside Location by front door

Current rating 100 A Fuse/device rating or setting 100 A f RCD main switch

Rated residual operating current(I) N/A mA Rated time delay N/A ms

BS(EN) 60947-3 Voltage rating 230 V Measured operating

Section K. Observations

Referring to the attached schedules of inspection and test results, and subject to the limitations specified at the Extent and limitations of the Inspection and testing section.

No. OBSERVATION(S)

CLASSIFICATION

CODE

C2

4.18 RCD(s) provided for fault protection – includes RCBOs (411.4.204;411.5.2; 531.2)

4.19 RCD's provided for additional protection/requirements includes RCBO's (411.3.3; 415.1)

No RCD protection 3 & 4

- 5.12 Provision of additional requirements for protection by RCD not exceeding 30mA
 - For all socket-outlets of rating 32 A or less, unless an exemption is permitted (411.3.3)
 - For supply to mobile equipment not exceeding 32A rating for use outdoors (411.3.3)
 - For cables concealed in walls at a depth of less than 50mm (522.6.202; 522.6.203)
 - For For cables concealed in walls/partitions containing metal parts regardless of depth (522.6.203)

Circuit 3 & 4 no RCD protection

5.18 Condition of accessories including socket outlets, switches and joint boxes (651.2 (v))


C3

Bathroom shaver light not functioning



One of the following codes, as appropriate, has been allocated to each of the observations made above to indicate to the persons(s) responsible for the installation the degree of urgency for remedial action.

- C1 Danger Present, Risk of injury. Immediate remedial action required
- C2 Potentially dangerous urgent remedial action required
- C3 Improvement recommended
- FI Further investigation required without delay

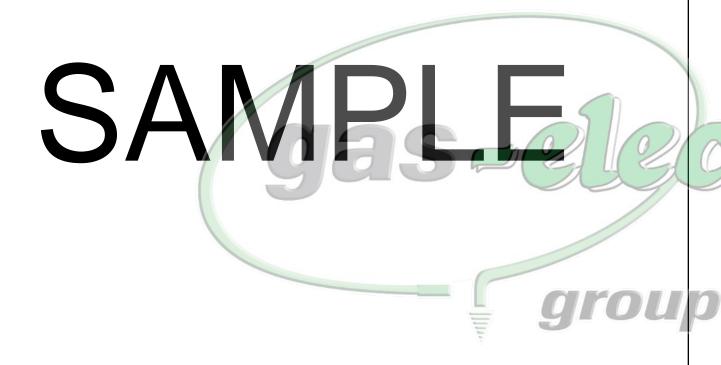

Page 4 of 12



Section O. Schedule of circuit details

DB reference no 1

Location Shed-cupboard wall (Squar

Zs at DB 0.28 **I at DB(kA)** 0.82

Correct Polarity of supply YES

confirmed

Phase rotation confirmed N/A

Details of circuits and/or installed equipment vulnerable to damage when testing

Smoke detectors

Details of test instruments used(state serial and/or asset

Continuity 23I-1414
Insulation resistance 23I-1414
Earth fault loop impedance 23I-1414
Earth electrode resistance RCD 23I-1414


Test	ed by :																	Test resu	ılts	1	1		
	e (Capital	s)																					
	ature :	,				Date :	22-May	y-2020			Ring fin circui	it	Contin (ohm			Res	sulation sistance ga ohms)						
			Circ	uit Det	ails						(ohms					, ,)					
				Protec	tive D	Device	Cond	uctor D	etails									6	0/				
Circuit Number	Circuit Description	Туре	Rating In A	Breaking capacity	RCD In (mA)	Maximum Permitted Zs	Reference method	Live (mm2)	Cpc (mm2)	r1 (Line)	Rn (Neutral)	r2 (CPC)	(R1 +R2)	R2	Insulation Resistance Test	Live / Live	Live / Earth	Polarity	Maximum measured (Zs) (Ohms)	RCD*5 time(ms)	RCD Test Button Operation	Manual AFDD test button operation	Remarks
1	Main switch	BS 60947 -3	100	6	N/A	N/A		16.0	16.0	I/A		V/A	J/A	N/A	A	N/A	N/A	Yes		N/A	N/A	N/A	
2	Lights bedroom/lo unge	BS(E N) 61009 -Type B	6	6	30	5.82	A & B	1.5	1.0	N/A	N/A	N/A	0.67	N/A	25 0		>999	Yes	0.95	8.9	Pass	N/A	
3	Lights kitchen/bat hroom	s) BS(E N) 61009 -Type B (0.4/5	6	6	30	5.82	A & B	1.5	1.0	N/A	N/A	N/A	0.38	N/A	25 n	LIM	>999	Yes	0.66	28.5	Pass	N/A	
4	RCD 1	s) BS (EN) 61008	80	6	30	0.4	N/A	0	0	N/A	N/A	N/A	N/A	N/A	N/ Δ	N/A	N/A	Yes	N/A	N/A	N/A	N/A	RCD not used but is connected to busbar with 2 x RCBO's



								Ele	Ctric	ai in	stall	atio	n Con	alt	ion Ke	porτ -	FICK						
5	Cooker point	BS (EN) 60898 Type B	32	6	30	1.1	A & B	6.0	2.5	N/A	N/A	N/A	0.09	N/A	25 n	LIM	>999	Yes	0.37	N/A	N/A	N/A	No RCD protection
6	Socket outlets Kitchen	BS (EN) 60898 Type B	32	6	30	1.1	A & B	2.5	1.5	0.19	0.19	0.31	0.13	N/A	25 n	LIM	>999	Yes	0.39	N/A	N/A	N/A	No RCD protection
7	Spare	N/A	N/A		N/A	N/A	N/A	0	0	N/A	N/A	N/A	N/A	N/A	N/	N/A	N/A	N/A	N/A	N/A	N/A	N/A	
8	Spare	N/A	N/A		N/A	N/A	N/A	0	0	N/A	N/A	N/A	N/A	N/A	Ν/	N/A	N/A	N/A	N/A	N/A	N/A	N/A	
9	Spare	N/A	N/A		N/A	N/A	N/A			N/	N/A	N/A	N/A	/A	201			N/A		N/A	N/A	N/A	
10	RCD 2	BS (EN) 61008	80	6	30	0.4	N/A	0	9	N/A	N/A	N/A	N/A	N/A	N/ Δ	N/A	N/A	Yes	N/A	28	Pass	N/A	
11	Socket outlets Throughout	BS (EN) 60898 Type B	32	6	30	1.1	A & B	2.5	1.5	0.50	0.49	0.83	0.34	N/A	25 n	LIM	>999	Yes	0.58	28	Pass	N/A	
12	Smoke detector	BS (EN) 60898 Type B	6	6	30	5.82	A&B	1.5	1.0	N/A	N/A	N/A	0.06	N/A	25 0	LIM	>999	Yes	0.34	28	Pass	N/A	
13	Spare	N/A	N/A		N/A	N/A	N/A	0	0	N/A	N/A	N/A	N/A	N/A	N/	N/A	N/A	N/A	N/A	N/A	N/A	N/A	
14	Spare	N/A	N/A		N/A	N/A	N/A	0	0	N/A	N/A	N/A	N/A	N/A	N/ A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	
																					<u>.</u>		



15	Spare	N/A	N/A	N/A	N/A	N/A	0	0	N/A	N/A	N/A	N/A	N/A	N/ A	N/A							

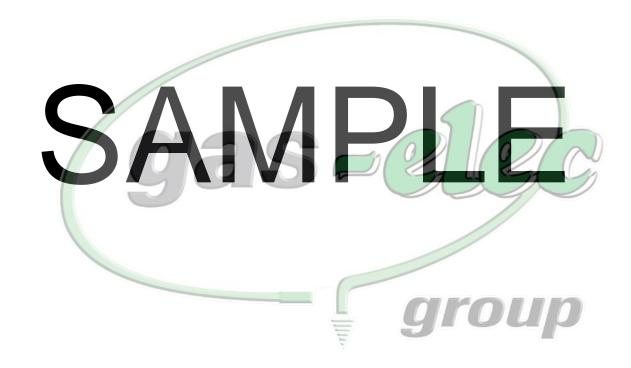



DISTRIBUTION BOARD INSPECTION SCHEDULE FOR SINGLE DISTRIBUTION BOARD INSTALLATIONS

N. Schedule of inspections for the main intake and associated circuits for use with Electrical Installation Condition Report

	ES Acceptable AC Unacceptable state C1 Improvement State Not NV Limitation Lim Not applicable condition condit		Further Investigation	FI
ГЕМ	DESCRIPTION	\neg	OUTCOM	1E
ON			(Use codes d	above
			Provide addit	
			comments wi	
			appropria	te)
1.0 1.1	EXTERNAL CONDITION OF INTAKE EQUIPMENT (VISUAL INSPECTION ONLY) Service Cable	\dashv	AC	
1.2	Service Head	\dashv	LIM	
1.3	Earthing Arrangement	-	AC	
1.4	Meter tails	-+	AC	
1.5	Metering equipment	-+	AC	
1.6	Isolator (where present)	$-\!\!+$	NA	
1.0	isolator (where present)	_	INA	
	PRESENCE ADEQUATE ARR A EMENT A ROTHE / OUR ES SUCI AS			
2.0	PRESENCE (ADEQUATE ARR M EMENTS + R OTHE / OUR ES SUC) AS MICROGENE, TORS (551.6; 5) .7)		NA	L
3.0	EARTHING/PONDING A RAN JEWIEN I (411 CH. P. 4)	-+		
3.1	Presence and political dispostor's earning rrange lent (42.1, 1; 542.1.2.2)		AC	
3.2	Presence and condition of earth electrode connection where applicable 9542.1.2.3)		NA	
3.3	Provision of earthing/bonding labels at all appropriate locations (514.13.1)	-+	AC	_
3.4	Confirmation of earthing conductor size (542.3; 543.1.1)	+	AC	
3.5	Accessibility and condition of earthing conductor and MET (543.3.2)	$-\!\!+\!\!$	AC	
		$-\!\!+\!\!$	AC	
3.6	Confirmation of main protective conductor sizes (544.1)	\rightarrow		
3.7	Condition and accessibility of main protective bonding conductor connections (543.3.2; 544.1		AC	
3.8	Accessibility and condition of other protective bonding connections (543.3.1; 543.3.2)	3/	AC	
4.0	CONSUMER UNIT(S) /DISTRIBUTION BOARD(S)	- P		
4.1	Adequacy of working space/accessibility to consumer unit/distribution board (132.12; 513.1)		AC	
1.2	Security of fixing (134.1.1)		AC	
4.3	Condition of enclosure(s) in terms of IP rating etc (416.2)		AC	
4.4	Condition of enclosure(s) in terms of fire rating etc (421.1.1.201; 526.5)		AC	
1.5	Enclosure not damaged/deteriorated so as to impair safety (651.2)		AC	
1.6	Presence of main linked switch (as required by 462.1.201)		AC	
1.7	Operation of main switch (functional check) (643.10)		AC	
4.8	Manual operation of circuit breakers and RCDs to prove disconnection (643.10)		AC	
4.9	Correct identification of circuit details and protective devices (514.8.1; 514.9.1)	0	AC	
.10	Presence of RCD six-monthly test notice at or near consumer unit/distribution board (514.12.2	U	AC	_
1.11	Presence of non-standard (mixed) cable colour warning notice at or near consumer unit / distribution board (514.14)		AC	
1.12	Presence of alternative supply warning notice at or near consumer unit/distribution board (514		NA	
.13	Presence of other required labelling (please specify) (Section 514)		NA	
1.14	Compatibility of protective devices, bases and other components; correct type and rating (No Signs of unacceptable thermal damage, arcing or overheating) (411.3.2; 411.4; 411.5; 411.6; Sections 432,		AC	
l.15	Single-pole switching or protective devices in line conductor only (132.14.1; 530.3.3)	\neg	AC	
1.16	Protection against mechanical damage where cables enter consumer unit/distribution board		AC	



	group	
4.17	Protection against electromagnetic effects where cables enter consumer unit/distribution	AC
4.18	board/enclosures (521.5.1) RCD(s) provided for fault protection - includes RCBOs (411.4.204;411.5.2; 531.2)	C2
4.10	RCD's provided for additional protection/requirements - includes RCBO's (411.3.3; 415.1)	C2
4.19	Confirmation of identification that SPD is functional (651.4)	NA
4.21	Confirmation that ALL conductor connections, including connections to busbars, are correctly	AC
7.21	located in terminals and are tight and secure (526.1)	710
4.22	Adequate arrangements where generating set operates as a switched alternative to the public supply (551.6	NA
4.23	Adequate arrangements where a generating set operates in parallel with the public supply (551.7)	NA
5.0	FINAL CIRCUITS	
5.1	Identification of conductors (514.3.1)	AC
5.2	Cables correctly supported throughout their run (521.10.202; 522.8.5)	LIM
	, , , , , , , , , , , , , , , , , , , ,	
5.3	Condition of insulation of live parts (416.1)	AC
5.4	Non-sheathed call a projected by engagure in complit, ducting trun (2.1)	LIM
	To include its grity of conduit at a trucking symple (metal a trucking symple)	AC
5.5	Adequacy of cables seems carrying calacity with it hard in the type and the control of the installation (Section 523)	AC
5.6	Coordination better contactor and overly diplatective evice (433 ; 533.2.1)	AC
5.7	Adequacy of protective devices, type and rated current for rault protection (411.3)	AC
5.8	Presence and adequacy of circuit protective conductors 411.31; Section 543)	AC
5.9	Wiring system(s) appropriate for the type and nature of the installation and external influences (Section 522)	AC
5.10	Concealed cables installed in prescribed zones (see Section D. Extent and limitations) (522.6.202)	LIM
5.11	Cables concealed under floors, above ceilings or in walls/partitions, adequately protected against damage (see Section D. Extent and Limitations)	LIM
5.12	Provision of additional requirements for protection by RCD not exceeding 30mA	
	For all socket-outlets of rating 32 A or less, unless an exemption is permitted (411.3.3)	C2
	For supply to mobile equipment not exceeding 32A rating for use outdoors (411.3.3)	C2
	For cables concealed in walls at a depth of less than 50mm (522.6.202; 522.6.203)	C2
	For cables concealed in walls/partitions containing metal parts regardless of depth(522.6.203)	C2
	Final circuits supplying luminaires within domestic (household) premises (411.3.4)	AC
5.13	Provision of fire barriers, sealing arrangements and protection against thermal effects (Section 527)	LIM
5.14	Band II cables segregated/separated from Band I cables (528.1)	LIM
5.15	Cables segregated/separated from communications cabling (528.2)	LIM
5.16	Cables segregated/separated from non-electrical services (528.3)	LIM
5.17	Termination of cables at enclosures - indicate extent of sampling in section D of the report (Section 526)	
	Connections soundly made and under no undue strain (526.6)	AC
	No basic insulation of a conductor visible outside enclosure (526.8)	AC
	Connections of live conductors adequately enclosed (526.5)	AC
E 40	Adequately connected at point of entry to enclosure (glands, Bushes etc) (522.8.5)	AC
5.18	Condition of accessories including socket outlets, switches and joint boxes (651.2 (v))	C3
	Cuitability of accessories for outsmall influences (F12.2)	AC
5.19	Suitability of accessories for external influences (512.2)	Λ0



	, , ,	
5.21	Single-pole switching or protective devices in line conductor only (132.4.1; 530.3.3)	AC
6.0	LOCATION(S) CONTAINING A BATH OR SHOWER	
6.1	Additional protection for all low voltage (LV) circuits by RCD not exceeding 30mA (701.411.3.3)	AC
6.2	Where used as a protective measure, requirements of SELV or PELV met (701.414.4.5)	NA
6.3	Shaver sockets comply with BS EN 61558-2-5 formerly BS3535 (701.512.3)	AC
6.4	Presence of supplementary bonding conductors, unless required by BS 7671:2018 (701.415.2)	NA
6.5	Low voltage (e.g. 230 volt) socket outlet sited at least 3M from zone 1 (701.512.3))	AC
6.6	Suitability of equipment for external influences for installed location in terms of IP rating (701.512.2)	AC
6.7	Suitability of accessories and controlgear etc for a particular zone (701.512.3)	AC
6.8	Suitability of current-using equipment for particular position within the location (701.55)	NA
7.0	OTHER PART 7 SPECIAL INSTALLATIONS OR LOCATIONS	
7.1	List all other special lock ons precent if any. (Learnd separately the esults of participar inspections applied)	NA



Certificate no. 1512008



CONDITION REPORT. GUIDANCE FOR RECIPIENTS

This report is an important and valuable document which should be retained for future reference.

- 1. The purpose of this Condition Report is to confirm, so far as reasonably practicable, whether or not the electrical installation is in a satisfactory condition for continued service (see Section E). The Report should identify any damage, deterioration, defects and/or conditions which may give rise to danger (see Section K).
- 2. The person ordering the Report should have received the "original" Report and the inspector should have retained a duplicate.
- 3. The "original" Report should be retained in a safe place and be made available to any person inspecting or undertaking work on the electrical installation in the future. If the property is vacated, this Report will provide the new owner/occupier with details of the condition of the electrical installation at the time the Report was issued.
- 4. Where the installation incorporates a residual current device (RCD) there should be a notice at or near the device stating that it should be tested six-monthly. For safety reasons it is important that this instruction is followed.
- 5. Section D (Extent and Limitations) should identify fully the extent of the installation covered by this Report and any limitations on the inspection and testing. The inspector should have agreed these aspects with the person ordering the Report and with other interested parties (licensing authority, insurance company, mortgage provider and the like) before the inspection was carried out.
- 6. Some operational limitations such as inability to gain access to parts of the installation or an item of equipment may have been encountered during the inspection. The inspector should have noted these in Section D.
- 7. For items classificating section K as a ("Dang spresent") the section working the inclanation is at risk, and it is recommended to the skilled person of appetent reflectric lessal tion working trakes the eccessary remedial work immediately.
- 8. For items classified in Section K a Ca Poter all, dar (erc s"), are sarety of a pose using the installation may be at risk and it is recommended that skilled ters at complete and it is recommended that skilled ters at complete and it is recommended that skilled ters at complete and it is recommended that skilled ters at complete and it is recommended to the recommendation of the recommendat
- 9. Where it has been stated in Section K that an observation requires further investigation (code FI) the inspection has revealed an apparent deficiency which may result in a code C1 or C2, and could not, due to the extent or limitations of the inspection, be fully identified. Such observations should be investigated without delay. A further examination of the installation will be necessary, to determine the nature and extent of the apparent deficiency (see Section F).
- 10. For safety reasons, the electrical installation should be re-inspected at appropriate intervals by a skilled person or persons, competent in such work. The recommended date by which the next inspection is due is stated in Section F of the Report under 'Recommendations' and on a label at or near to the consumer unit/distribution board.

CONDITION REPORT INSPECTION SCHEDULE GUIDANCE FOR THE INSPECTOR

- 1. Section 1.0. Where inadequacies in the distributor's equipment are encountered the inspector should advise the person ordering the work to inform the appropriate authority.
- 2. Older installations designed prior to BS 7671:2008 may not have been provided with RCDs for additional protection. The absence of such protection should as a minimum be given a code C3 classification (item 5.12).
- 3. The schedule is not exhaustive.
- 4. Numbers in brackets are Regulation references to specified requirements.





Additional Comment

Hard wired smoke detector expired in 2018

SAMPLE group

This report has been produced in accordance with the Gas-Elec Group working method statement which covers COVID -19 virus procedures. A copy of this working method statement can be found on: www.gas-elec.co.uk/cvd19

This report has been completed and issued by Gas-elec Safety (UK) Ltd

Estimate ID: 325119

ESTIMATE



To: From: Area 003

Bowercombe South Hill Somerton Somerset TA11 7JQ

 Tel:
 08450 703 404/5

 Freephone:
 0800 587 9999

 Fax:
 08450703402

E-mail: area1@gas-elec.co.uk

Website: www.gas-elec.co.uk

Date: 22-May-2020

RE:

Dear

Thank you for the opportunity to provide an estimate for the remedial works at the above property. Following our survey at the property, the cost to implement the recommended work will cost £440.00 plus VAT (which includes all parts and labour).

For details of the works required at the above property, please see the comments on the following page.

uld like to pro This estimate is valid e. If you eu wiin ine works, from the e shown please contact us by 8450 70 nplete and return co.uk. Al ely, please c hone on 5 or by area1 nat the Order Confirmation

gas-elec and all of the gas-elec align ers are relisteral with a gredit tion dies and are quilified to carre out all types of gas & electrical remedial value collections also able to relistent with a gredit tion dies and are quilified to carre out all types of gas & electrical remedial value collections also able to relistent with a gredit tion dies and are quilified to carre out all types of gas & electrical remedial value collections.

Yours sincerely,

Manager

Area 003

group

Gas-elec Safety (UK) Ltd Page 1 of 3

Estimate ID: 325119

ESTIMATE



Details of works required:

To undertake required remedial works as shown as Code - C2, Move MCB's circuit 3&4 to RCD protected side of Consumer Unit. Cost of these works alone £130.00 + VAT

To undertake recommended remedial works as shown as Code - C3, Supply and fit replacement bathroom sahaver light Supply and fit hard wired smoke alarm



Gas-elec Safety (UK) Ltd Page 2 of 3


Estimate ID: 325119

ESTIMATE



Terms & Conditions

- 1. The estimate is valid for 28 days.
- 2. Work will only commence on receipt of a deposit of 50% of the value of the installation.
- 3. The estimate is for the works as detailed on the estimate letter. Any extra work will need to be paid for separately.
- 4. Work will commence on receipt of the signed order at the bottom of this estimate.
- 5. All work is guaranteed for 12 months from the date of installation.
- 6. Please note that if you choose to pay by credit card, you may be charged a fee for this method of payment. If you choose to pay by debit card, no additional charges will apply.

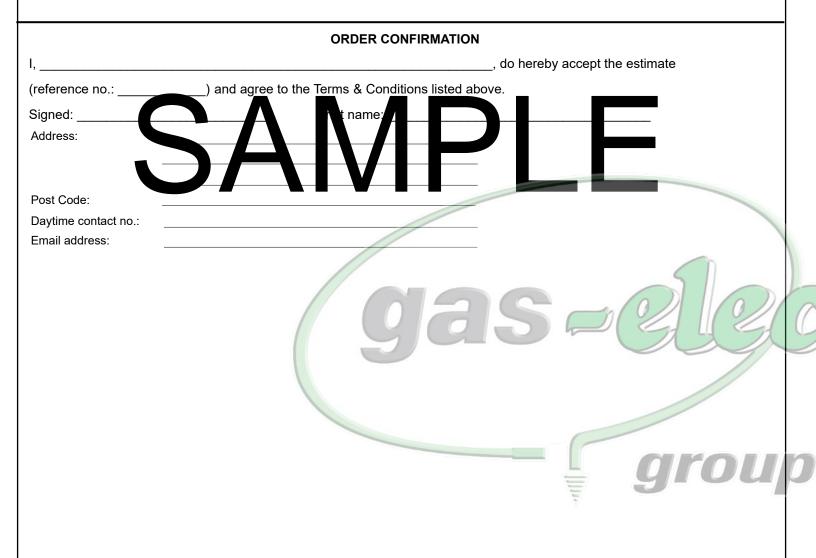

Gas-elec Safety (UK) Ltd Page 3 of 3

Accompanying Photos



Gas-elec Group Summer Road, Walsham - Le - Willows, Bury St Edmunds, IP31 3AJ 7PJ TEL: 0800 5879999 Job No.: 1512008

Date: 22/05/2020





Accompanying photos provided by the engineer

Description: CONSUMER UNIT



Description: CONSUMER UNIT



Description: CONSUMER UNIT



Description: SMOKE DETECTOR



The results shown on this report reflect the situation at the time of the inspection. Gas-Elec, its employees and engineers cannot be held responsible for any failure of the boiler or heating system after the inspection.

The report is a general visual, surface and functional examination of the central heating and / or plumbing system without risk of causing damage to the property or injury to the inspector. Due care is therefore exercised throughout the inspection regarding safety, practically and the constraints of being a visitor to the property (which may be occupied). Furniture, floor coverings and the contents are not moved or lifted and no part is forced or laid open to make accessible. Gas-elec Safety (UK) Ltd. or it's employees accept no liability for the consequences of any errors or omissions on this report.

Inspector:

Accompanying Photos



Gas-elec Group Summer Road, Walsham - Le - Willows, Bury St Edmunds, IP31 3AJ 7PJ TEL: 0800 5879999 Job No.: 1512008

Date: 22/05/2020





Accompanying photos provided by the engineer

Description: BATHROOM SHAVER LIGHT



SAMPLE gas-et

The results shown on this report reflect the situation at the time of the inspection. Gas-Elec, its employees and engineers cannot be held responsible for any failure of the boiler or heating system after the inspection.

The report is a general visual, surface and functional examination of the central heating and / or plumbing system without risk of causing damage to the property or injury to the inspector. Due care is therefore exercised throughout the inspection regarding safety, practically and the constraints of being a visitor to the property (which may be occupied). Furniture, floor coverings and the contents are not moved or lifted and no part is forced or laid open to make accessible. Gas-elec Safety (UK) Ltd. or it's employees accept no liability for the consequences of any errors or omissions on this report.

Inspector:

Landlords / Homeowner Gas Safety Record - G2



Gas-elec Group Summer Road, Walsham - Le - Willows, Bury St Edmunds, IP31 3AJ



Access Date: Wednesday, 1 April, 2020 Next expiry date: Thursday, 1 April, 2021

Client:

Cert. No: CT-0041446-1485381001

Site Add.:

Gas Inspectior	n Details								
Meter Reading	Meter / ECV Location	AECV location (if app)	Meter Visual Inspection	Meter Type	ECV Accessible	Gas Installation Pipework	Let-By/Tightness Test	Record Pressure Drop	Protective Earth Bond
N/A	LPG	Outside	N/A	LPG	Yes	Pass	Pass / Pass	0	No

N/A	LPG	Outside	N/A	LPG Yes Pass Pa		Pass / Pass	0	No	
Gas Appliance	e Details	Condensing Boiler		Cooker					
Location		kKitchen		Kitchen					
Make		Worcester		Beko					
Model #		Greenstar 12Ri Lpg		N/F					
Serial #		55707540000137733600075		N					
Flue Type		Room Sealed		e ş					
Safety Device		Pass		ass					
Operating Pres	sure/Gas Rate	35.00 mbar		35.00 m					
Ventilation Ade	quate	Yes		169					
Flue Flow Test		N/A		N/A					
Spillage Test		N/A		N/A		 0			
Termination Sa		Yes		N/A		//		(/ %)	
Visual Condition		Pass		Pass					
Appliance Serv		No		No					
ID, AR or Advis		N/A		N/A					
Gas Council Nu		41-406-42		N/F					
Flue Gas Analy	sis (Ratio)	0.0016			nce is not a boiler				
Safe To Use		Yes		Yes					
Appliance relate	ed comments:	No engineer comment		No engineer cor	nment	9	rou	D	

In the event of a complaint relating to any service or installation in a property gas-elec must be given the opportunity to address the issue by re-visiting the property to resolve any alleged complaint. gas-elec cannot be held responsible if the opportunity to fully address the matter is not afforded to us. In the event of another company/contractor being called to the property to investigate or attempt to rectify an alleged complaint in preference to gas-elec the company will accept no liability. A detailed internal inspection of the flue integrity, construction and lining has not been carried out. I confirm that the situation(s) recorded above, has been identified and brought to the attention of the Responsible Person in

This Safety Record Issued By

Name

This report has been produced in accordance with the Gas-Elec Group working method statement which covers COVID -19 virus procedures.

A copy of this working method statement can be found on: www.gas-elec.co.uk/cvd19

Next Inspection Due Within 12 Months

(Please refer to 'General Comments' page for comments made by the engineer regarding the installation)

Landlords / Homeowner Gas Safety Record - G2



Gas-elec Group Summer Road, Walsham - Le - Willows, Bury St Edmunds, IP31 3AJ



Access Date: Wednesday, 1 April, 2020 Next expiry date: Thursday, 1 April, 2021

Client:

Cert. No: CT-0041446-1485381001

Site Add.:

General comments:



Electrical Bonding

Most types of electrical installations are fitted with main protective bonding conductors, which is the connection to the internal gas and water pipes to the installations earth terminal. In particular those installations with P.M.E (Protective Multiple Earth) must, by law, be fitted with protective earth bond. The gas installation pipe fitted in your premises does not appear to be fitted with a main protective bonding conductor. I am required by the gas Safety (Installation and use) Regulations, to inform you that any necessary protective earth bonding work should be carried out by a competent person. I advise you to have the installation checked by an electrically competent person. No electrical installation work should be undertaken until the lack of protective bonding is checked by an electrically competent person. If you are a tenant of this property, would you please bring this requirement to the attention of the owner/landlord or their managing agent.

Plumbing Condition Report



Gas-elec Group Summer Road, Walsham - Le - Willows, Bury St Edmunds, IP31 3AJ

TEL: 0800 5879999

Job No.: 1485381

Date: 01/04/2020





Client:	
Property Inspected:	
,	

Item tested	Condition	Comments
Hot Water operates effectively	Fair	Some taps could do with replacing
Kitchen sink & plumbing	Fair	Taps and sink are good as is visible plumbing
Utility room & plumbing	N/A	
Washing machine etc. & plumbing	N/A	
Dishwasher & plumbing	N/A	
Ground floor WC & plumbing	Fair	The WC's and sink and bath are in good condition The taps in bathroom should be replaced
En suite other	N/A	(das - 2) 0
Family bath room & Plumbing	Fair	Taps in poor condition
Condition of baths & showers	Good	Electric shower has been removed Bath in fair condition

This report has been produced in accordance with the Gas-Elec Group working method statement which covers COVID -19 virus procedures. A copy of this working method statement can be found on: www.gas-elec.co.uk/cvd19

The results shown on this report reflect the situation at the time of the inspection.	Gas-Elec,	its employees and	d engineers cannot
be held responsible for any failure of the boiler or heating system after the inspec	ction.		

The report is a general visual, surface and functional examination of the central heating plumbing system without risk of causing damage to the property or injury to the inspector. Due care is therefore exercised throughout the inspection regarding safety, practically and the constraints of being a visitor to the property(which may be occupied).furniture, floor coverings and the contents are not moved or lifted and no part is forced or laid open to make accessible.

Gas-elec Safety (UK) Ltd. or it's employees accept no liability for the consequences of any errors or omissions on this report.

ı	n	S	p	е	C	C	J	r	

Plumbing Condition Report



Gas-elec Group Summer Road, Walsham - Le - Willows, Bury St Edmunds, IP31 3AJ

TEL: 0800 5879999

Job No.: 1485381

Date: 01/04/2020





Item tested	Condition	Comments
Hot Water Storage	Fair	Located in the loft has a lagging jacket
Operation of immersion elements	Fair	Switch is located in hallway
Cold Water Storage Tank	Fair	Plastic tanks with lids and lagging jackets
Water flow rat Main	. –air	Tank follopt water and banroom Vains recourse and vater opart and he stem
Low Pressure	air	
Stopcock		Located in a kitchen cupboard is working and good condition
Outside tap.	Fair	No non return valve fitted

The results shown on this report reflect the situation at the time of the inspection. Gas-Elec, its employees and engineers
cannot be held responsible for any failure of the hoiler or heating system after the inspection

Overall condition: For the age or the property the condition is fair.

Some plumbing needed (taps & shower)

The report is a general visual, surface and functional examinatio of the central heating plumbing system without risk of causing damage to the property or injury to the inspector. Due care is therefore exercised throughout the inspection regarding safety, practically and the constraints of being a visitor to the property (which may be occupied). furniture, floor coverings and the contents are not moved or lifted and no part is forced or laid open to make accessible. Gas-elec Safety (UK) Ltd. or it's employees accept no liability for the consequences of any errors or omissions on this report.

Central Heating Condition Report



Gas-elec Group Summer Road, Walsham - Le -Willows, Bury St Edmunds, IP31 34 I

IP31 3AJ TEL: **0800 587 9999** **Job No.:** 1485381

Date: 01/04/2020





Client:	
Property Inspected:	

Boiler Details				
Boiler- Make	Model:	Approx Age in years	Type of Boiler	Location
Worcester	Greenstar 12 Ri	3+		Kitchen
	'Lpg	I	I	·

Item tested	Result	Comments
Boiler Condition	Good	
Central heating pump	N/A	Located in loft
Heating control and timer	Fair	Honeywell. Hot water not working
Room Therm Late	Fair	Hotely ell
Earth bondil to pip work and boiler	N/	
Motorised Valve(s)	Fair	Heating working
Feed/Expansion tank insulation	Good	Lagged and lid fitted
Fuel Storage Tank and pipe work	N/A	943-64
Discharge/Condense Pipe	Good	
Drain off cock	Fair	Some rads have no drain off valves
TRV (Thermostatic Radiator Valves)	Fair	All working

The results shown on this report reflect the situation at the time of the inspection. Gas-Elec, its employees and engineers cannot be held responsible for any failure of the boiler or heating system after the inspection.

The report is a general visual, surface and functional examination of the central heating and / or plumbing system without risk of causing damage to the property or injury to the inspector. Due care is therefore exercised throughout the inspection regarding safety, practically and the constraints of being a visitor to the property (which may be occupied). Furniture, floor coverings and the contents are not moved or lifted and no part is forced or laid open to make accessible. Gas-elec Safety (UK) Ltd. or it's employees accept no liability for the consequences of any errors or omissions on this report.

This report has been produced in accordance with the Gas-Elec Group working method statement which covers COVID -19 virus procedures. A copy of this working method statement can be found on: www.gas-elec.co.uk/cvd19

Inspector:

Central Heating Condition Report



Gas-elec Group Summer Road, Walsham - Le -Willows, Bury St Edmunds,

IP31 3AJ TEL: **0800 587 9999** **Job No.:** 1485381

Date: 01/04/2020





Condition of radiators	Good
Number of radiators	8
Radiators function correctly	Yes
Radiators function efficiently	Yes

Other relevant information: All rads heating up

Comments:

gase

The results shown on this report reflect the situation at the time of the inspection. Gas-Elec, its employees and engineers cannot be held responsible for any failure of the boiler or heating system after the inspection.

The report is a general visual, surface and functional examination of the central heating and / or plumbing system without risk of causing damage to the property or injury to the inspector. Due care is therefore exercised throughout the inspection regarding safety, practically and the constraints of being a visitor to the property (which may be occupied). Furniture, floor coverings and the contents are not moved or lifted and no part is forced or laid open to make accessible. Gas-elec Safety (UK) Ltd. or it's employees accept no liability for the consequences of any errors or omissions on this report.

Inspector:

Accompanying Photos



Gas-elec Group Summer Road, Walsham - Le - Willows, Bury St Edmunds, IP31 3AJ 7PJ TEL: 0800 5879999 **Job No.:** 1485381

Date: 01/04/2020





Accompanying photos provided by the engineer

Description: Boiler



Description: Cooker



Descripti : Loft



scration: Shower



The results shown on this report reflect the situation at the time of the inspection. Gas-Elec, its employees and engineers cannot be held responsible for any failure of the boiler or heating system after the inspection.

The report is a general visual, surface and functional examination of the central heating and / or plumbing system without risk of causing damage to the property or injury to the inspector. Due care is therefore exercised throughout the inspection regarding safety, practically and the constraints of being a visitor to the property (which may be occupied). Furniture, floor coverings and the contents are not moved or lifted and no part is forced or laid open to make accessible. Gas-elec Safety (UK) Ltd. or it's employees accept no liability for the consequences of any errors or omissions on this report.

Inspector: